



**Safety Lab Plus, Inc.**  
Analysis for Work, Play & More...

# Air Quality Analysis Report

## Cruise Fish Dive, Inc. Bauer Capitano 5-7cfm

### CRUI34134

Cruise Fish Dive, Inc.  
28811 South Tamiami Trail, Ste. 3  
Bonita Springs, FL 34134  
Captain Mark Garcy

### SLP33332

Safety Lab Plus, Inc.

Sample Date: 4/3/2024  
Analysis Date: 4/6/2024  
Report ID: 040624140721  
Taken By: Mark Garcy

Sample ID: 140721  
Standard: CGA E (2018)  
Frequency: Quarterly

Results: \*\* Sample Meets Standard \*\*  
Also Meets: CGA D (2018), OSHA (2006)



*Robert Laughlin*  
Robert Laughlin - Lab Director




CGA  
Compressed Gas Association

OSHA



Analytes / Elements	Qtr. 1 4/6/2024				Limits / Range
Oxygen (%)	20.9				20 - 22
Carbon Dioxide (ppm)	512.66				1000
Carbon Monoxide (ppm)	<1				10
Methane (ppm)	<1				25
H2O / Dew Point (ppm/°F)	18.8 / -68.3				67 / -50
Oil & Particles (mg/m3)	<1				5
Unknowns	ND				NA
Odor	ND				None
Sample ID	140721.SPA				

### Instrument Readout

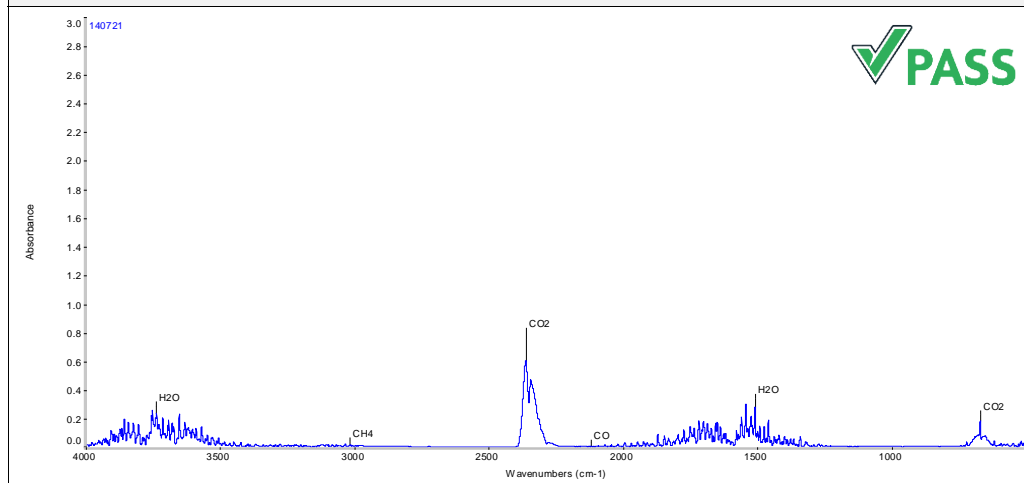

NOTICE: This air/gas sample was tested ONLY against the requested standard. It may contain undetected items outside the scope of analysis. Further analysis is available upon request. Results reported only relate to the items tested from the sample as received. Methods used: FTIR, Dewpoint, electrochemical, microgravimetry, microscopy and sniffing. Results are dependent on customer provided pressure values. Estimated Measurements of Uncertainty values for the reported analytes are available upon request. This report/certificate is issued for the sole use of name listed. Test results are confidential unless explicitly waived otherwise. This report/certificate shall not be reproduced and/or modified, unless in its entirety, without the consent of Safety Lab Plus, Inc. - 21066 Sheridan Street, Pembroke Pines, FL 33332 • www.safetylabplus.com • info@safetylabplus.com • 800-599-1617